

# **AQUATECH**

## **PARTS BULLETIN**

It has come to our attention that there was a running design change back in July of 1998 on the shifter forks on OMSI model PFT-PC2/3000 and PFT-PC4/3000 split shaft PTOs. The Aquatech PTO assembly part numbers affected are 164134, 164135, 164137, 164140 and 164141. The earlier design fork was held in place by roll pins. The current design uses a single bolt and nut. When replacing either the fork or the stem (shifter shaft) on the earlier design - both items will have to be replaced together. Also the newer design bolt and nut will be required. The part numbers involved are listed below.

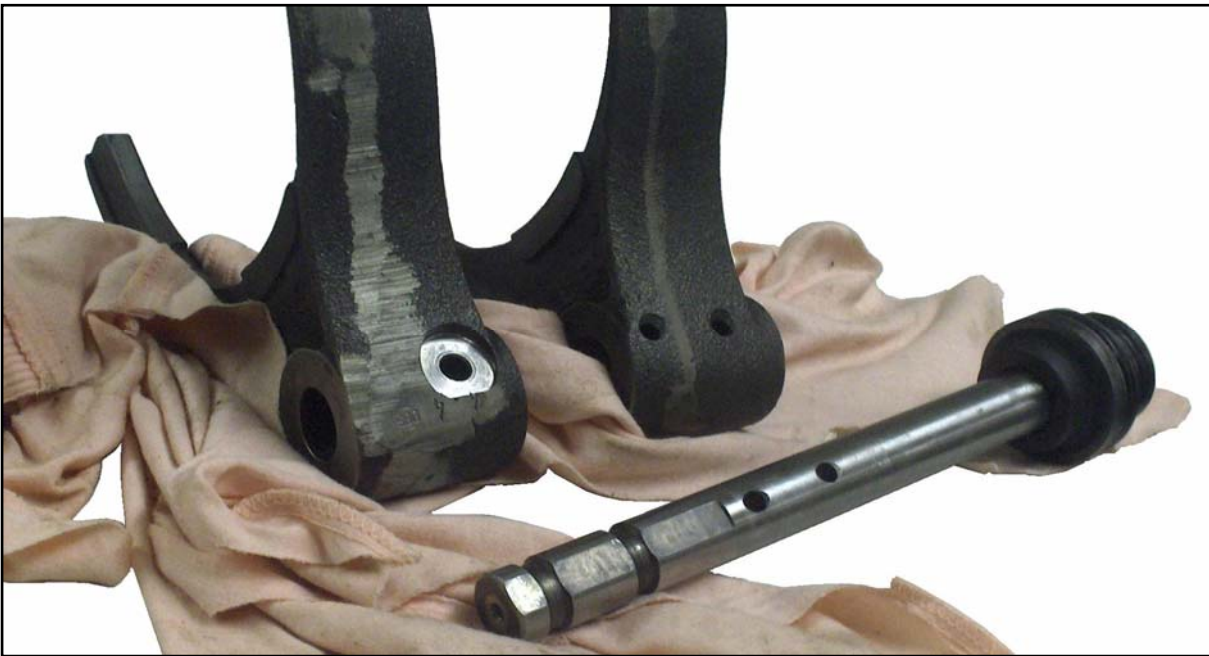


Photo submitted by Gary Karst, Terex Utilities West

**FOR ALL ASSEMBLIES LISTED ABOVE**

<b>A164440</b>	<b>Main Fork</b>
<b>A164435</b>	<b>Main Stem</b>
<b>A164402</b>	<b>Nut</b>
<b>A164441</b>	<b>Bolt</b>

**FOR A164141 ONLY \***

<b>A164468</b>	<b>Lateral Fork</b>
<b>A164470</b>	<b>Lateral Stem</b>
<b>A164402</b>	<b>Nut</b>
<b>A164441</b>	<b>Bolt</b>

\* The other assemblies are not affected on the lateral outputs because they have Power Clutch™ clutch packs.